

UNCLASSIFIED

AD NUMBER

AD905611

LIMITATION CHANGES

TO:

Approved for public release; distribution is unlimited.

FROM:

Distribution authorized to U.S. Gov't. agencies only; Administrative/Operational Use; 23 DEC 1971. Other requests shall be referred to National Aeronautics and Space Administration, Washington, DC.

AUTHORITY

NASA TR Server Website

THIS PAGE IS UNCLASSIFIED

AD 90561 I

CT No.

FILE COPY

LOCKHEED  
CALIFORNIA  
COMPANY

BURBANK, CALIFORNIA, U.S.A.

DDC

RECEIVED  
DEC 13 1972

E

The information disclosed herein was originated by and is the property of the Lockheed Aircraft Corporation, and except for uses expressly granted to the United States Government, Lockheed reserves all patent, proprietary, design, use, sale, manufacturing and reproduction rights thereto. Information contained in this report must not be used for sales promotion or advertising purposes.



ACCESSION NO.	
WIS	WIS 1000 0
UC	UC 1000 0
UNCLASSIFIED	0
UNRECORDED	
IN	
FEDERAL BUREAU OF INVESTIGATION	
U.S. DEPARTMENT OF JUSTICE	
13	

Distribution limited to U.S. Gov't. agencies only;  
Proprietary Information; 13 DEC 1972. Other requests  
for this document must be referred to

**LOCKHEED • CALIFORNIA COMPANY**  
A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REPORT NO. LR-25049

DATE 12-23-71

MODEL All

COPY NO. 15

TORQUE-TENSION RELATIONSHIPS AND  
STATIC PRELOAD LOSS OF HIGH STRENGTH,  
HEAT RESISTANT, AND CORROSION  
RESISTANT AIRCRAFT ALLOY FASTENERS

REFERENCE

(11) 23 Dec 71

(12) 38p.

CONTRACT NUMBER(S)

DEC 18 1972

DEVELOPED AT PRIVATE EXPENSE W/O 41-5587-5978

PREPARED BY:

(10) V. G./Hart

J. E./Jones

Components Engineer  
Parts and Equipment

Components Engineer, Sr.  
Parts and Equipment

APPROVED BY:

E. J. Murphy  
Design Specialist  
Parts and Equipment

APPROVED BY:

J. W. Dierbower  
Group Engineer  
Parts and Equipment

APPROVED BY:

W. R. Zelenka  
Department Manager  
Parts and Equipment

APPROVED BY:

R. L. Dickinson  
Division Manager  
Development Designer

The information disclosed herein was originated by and is the property of the Lockheed Aircraft Corporation, Division  
and except for use expressly granted to the United States Government, Lockheed reserves all patent,  
proprietary, design, use, sale, manufacturing and reproduction rights thereto. Information contained in this  
report must not be used for sales promotion or advertising purposes.

#### REVISIONS

REV. NO.	DATE	REV. BY	PAGES AFFECTED	REMARKS



Distribution limited to U.S. Gov't. agencies only;  
Proprietary Information; 13 DEC 1972. Other requests  
for this document must be referred to  
**LOCKHEED • CALIFORNIA COMPANY**  
A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REPORT NO. LR-25049

DATE 12-23-71

MODEL All

COPY NO. 15

TITLE  
TORQUE-TENSION RELATIONSHIPS AND  
STATIC PRELOAD LOSS OF HIGH STRENGTH,  
HEAT RESISTANT, AND CORROSION  
RESISTANT AIRCRAFT ALLOY FASTENERS

REFERENCE

CONTRACT NUMBER(S)

DEVELOPED AT PRIVATE EXPENSE W/O 41-5587-5978

PREPARED BY:

V. G./Hart

Components Engineer  
Parts and Equipment

J. F./Jones

Components Engineer, Sr.  
Parts and Equipment

APPROVED BY:

E. J. Murphy  
Design Specialist  
Parts and Equipment

APPROVED BY:

J. B. Bierbower  
Group Engineer  
Parts and Equipment

APPROVED BY:

W. R. Zelenka  
Department Manager  
Parts and Equipment

APPROVED BY:

R. L. Dickinson  
Division Manager  
Development Designer

The information disclosed herein was originated by and is the property of the Lockheed Aircraft Corporation. Division  
and except for user expressly granted to the United States Government, Lockheed reserves all patent,  
proprietary, design, use, sale, manufacturing and reproduction rights thereto. Information contained in this  
report must not be used for sales promotion or advertising purposes.

#### REVISIONS

REV. NO.	DATE	REV. BY	PAGES AFFECTED	REMARKS

**LOCKHEED • CALIFORNIA COMPANY**  
A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. LR 25049

PAGE NO. i

**I. ABSTRACT**

↓  
This report was prepared by the Parts and Equipment Department under an Independent Development Program. It describes torque-tension and static preload loss tests conducted on high strength, heat resistant, and corrosion resistant fasteners that are currently used or intended for future use in Lockheed-California Company aircraft. All testing was conducted by Almay Research and Testing Corporation. All fastener hardware was supplied by Lockheed. The results of this report may be used to determine the installation torque requirements for optimum joint preload.

The test data resulting from this program was generated by wrenching the nut and was limited to two installation cycles. The effect of two different added lubricants was determined. These lubricants were MIL-T-5544, a graphite base lubricant, and MIL-L-23398 (LAC-C34-1209A), a dry film lubricant.

The conclusions of this report are that the installation torque requirements of fasteners vary due to fastener materials, lubricants used, rated strength of the fastener, finishes, and installation cycle number. In addition, each installed fastener is subject to a loss of preload during the first 72 hours after installation; this loss may be as much as 11 percent of the initial preload.

**LOCKHEED • CALIFORNIA COMPANY**  
A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. LR 25049

PAGE NO. ii

**II. ACKNOWLEDGEMENTS**

The authors wish to acknowledge the valuable assistance provided during the course of this program by the following fastener companies: Elastic Stopnut Division of Amerace Esna Corporation, Kaynar Manufacturing Co., Inc., Omark Industries Precision Fastening Subsidiary, P. B. Fasteners Division of Paul R. Briles, Inc., Standard Pressed Steel Co., Valley Todeco, Inc., Subsidiary of The Lamson Sessions Co. and Voi-Shan, a division of VSI Corporation.

The authors further acknowledge the contribution of Almay Research and Testing Corporation in performance of the testing, which was accomplished under the competent direction of Mr. Harry S. Brenner.

**LOCKHEED • CALIFORNIA COMPANY**  
A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. \_\_\_\_\_

LR 25049

PAGE NO. \_\_\_\_\_

iii

**III. TABLE OF CONTENTS**

<u>SECTION</u>	<u>TITLE</u>	<u>PAGE</u>
I	ABSTRACT	i
II	ACKNOWLEDGEMENTS	ii
III	TABLE OF CONTENTS	iii
IV	LIST OF TABLES	iv
V	INTRODUCTION	1
VI	OBJECTIVE	3
VII	CONCLUSIONS/RECOMMENDATIONS	4
VIII	PARTS TESTED	7
IX	TEST SPECIMENS	12
X	TEST PROCEDURE	14
XI	DISCUSSION OF TEST RESULTS	17
XII	APPENDIX	19
	LIST OF REFERENCES	20
	BIBLIOGRAPHY	21
	IDC, PE70/522, J. B. Bierbower to G. W. Davis, Dated 7-28-70, Subject: Torque-Tension Relationship - Engine To Pylon Attach Bolts	25
	DISTRIBUTION LIST	33



**LOCKHEED • CALIFORNIA COMPANY**  
A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. LR 25049

PAGE NO. iv

IV. LIST OF TABLES

<u>TABLE</u>	<u>TITLE</u>	<u>PAGE</u>
I	TORQUE-TENSION TEST SPECIMEN COMBINATIONS	8
II	PRELOAD-LOSS TEST SPECIMEN COMBINATIONS	10

**LOCKHEED • CALIFORNIA COMPANY**

A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. LR 25049

PAGE NO. 1

**V. INTRODUCTION**

Shear, tension, and fatigue critical bolts and nuts require different installation torque limits in order to achieve optimum joint preload. Fatigue-sensitive, highly loaded joints are subject to premature failure of the structure or fastener if the fastener installation torque is below optimum. An installation torque greater than optimum can cause premature fastener failure by inducing preloads greater than the fastener yield strength. Torque-tension relationships for alloy steel, cadmium plated bolts and steel, cadmium plated, dry film lubricated nuts are well documented (1).<sup>\*</sup> These established relationships are available to designers via various reference manuals. The first objective of this test program was to establish torque-tension relationships for fasteners of materials other than those already documented. It had been suggested that fastener preload attained from torque is subject to a loss with time. This loss may be a result of relaxation in the joint or room temperature creep in the fastener. This phenomena has not been investigated to any great degree by prior investigators. The second objective of this program was to determine the magnitude of preload loss as a function of time for fasteners that are currently in use.

After this test program was initially defined a recent torque-tension test report (2) prepared by Almay Research and Testing Corporation under a NASA contract was made available to us. After review of this test report our proposed program was revised to eliminate duplication. The two programs now complement each other.

\*Numbers in parenthesis refer to references listed in the Appendix.

**LOCKHEED • CALIFORNIA COMPANY**  
A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. LR 25049

PAGE NO. 2

V. INTRODUCTION (Continued)

Almay Research and Testing Corporation was selected to conduct the testing for this program. Almay was chosen because: 1. they had just completed the torque-tension study for NASA (which resulted in a report of over 700 pages, see Ref 2), 2. they were located in the Los Angeles area so testing could be monitored and coordination could be conducted easily, and 3. their estimate of cost was in line with budget predictions. Testing was conducted under the supervision of Mr. Harry S. Brenner, Director of Research. Mr. Brenner offered to provide a written report, besides the test data required by contract at no additional charge. It was felt that this report, which includes observations, photos, description of test equipment, and comments, would add greatly to the value of this program. For this reason Mr. Brenner's offer was accepted. His report (3) has been submitted to the Lockheed-California Company library under separate cover. The Central Library Accession Number is 72-3296.

**LOCKHEED • CALIFORNIA COMPANY**  
A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. LR 25047

PAGE NO. 3

**VI. OBJECTIVE**

The first objective of this program was to provide torque-tension data for bolts and nuts from which installation torque requirements could be determined.

The second objective of this program was to determine the magnitude of any static preload loss, as a function of time, so that its significance could be established.

REVISIONS \_\_\_\_\_

REPORT NO. LR 25049

PAGE NO. 4

## VII. CONCLUSIONS/RECOMMENDATIONS

The test results will provide aircraft design engineers with accurate torque-tension relationships from which fastener optimum installation torque limits can be determined.

The data generated by this test program may result in: (1) longer lived, more reliable aircraft, (2) industry standardization of installation torque limits and methods, and (3) extending the life of the fastener wrenching surfaces.

It is recommended that further torque-tension tests be conducted on high strength, heat resistant, corrosion resistant fasteners. The object of these tests would be to determine the influence on joint preload due to:

- (1) Fastener yield to ultimate ratio caused by flush, hex, and 12-point bolt head configurations,
- (2) Wrenching the bolt versus wrenching the nut,
- (3) Nut configuration (thin wall, thick wall, and plate nut types),
- (4) Nonlocking versus self-locking nuts,
- (5) Varying the thread pitch from fine to coarse (in preparation for "intermediate" pitch of future metric standards),
- (6) Varying washer materials, heat treat levels, finishes, and dimensions,

**LOCKHEED • CALIFORNIA COMPANY**

A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. \_\_\_\_\_

LR 25049

PAGE NO. \_\_\_\_\_

5

**VII. CONCLUSIONS/RECOMMENDATIONS (Continued)**

- (7) 15 installation-removal cycles with and without added lubricants and methods of achieving minimum variation between cycles,
- (8) Sealants for either environmental or dissimilar metal protection, and
- (9) Other fastener materials. An example is Multiphase (MP-35N), a proprietary material of the Standard Pressed Steel Co. Multiphase has several properties that an excellent fastener alloy should have. It is elevated temperature resistant, has a very low magnetic permeability, is very corrosion resistant, heat treatable to 260 KSI minimum ultimate tensile strength, and dynamically it is at least equal to the best of the available noncorrosion resistant materials. It is hoped that any future torque-tension test program would include sufficient quantities of MP-35N bolts so that torque-tension relationship data for this material could be established.

Future preload loss studies are also recommended. The effect of vibration on preload loss in the joint needs to be determined.



**LOCKHEED • CALIFORNIA COMPANY**  
A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. \_\_\_\_\_

LR 25049

PAGE NO. \_\_\_\_\_

6

**VII. CONCLUSIONS/RECOMMENDATIONS (Continued)**

Finally it is recommended that the data generated by this program be reduced into a form more readily useable, by design engineers, in specifying installation torque limits for optimum joint preload. This information should be published in the Stress Memo Manual.

**LOCKHEED • CALIFORNIA COMPANY**

A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. LR 25049

PAGE NO. 7

**VIII. PARTS TESTED**

The parts tested are shown in Tables I and II. These parts were paired as shown in the tables. The tables also show that the parts were treated either as a tension combination or shear combination, and the added lubricant used, if any.

In some cases the as received parts were only tested with added lubricants. It was felt that these parts should always be installed with added lubricants in order to minimize the installation torque requirements, and that the adding of a lubricant would provide the most consistent torque-tension relationships between specimens and between installation cycles.

**LOCKHEED • CALIFORNIA COMPANY**

A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. LR 25049PAGE NO. 8**TABLE I - Torque-Tension Test  
Specimen Combinations**

<u>Bolt Part No.</u>	<u>Nut Part No.</u> *	<u>Combination Rating</u>	<u>Lubrication Condition</u>
NAS6403U12 NAS6404U15 NAS6405U31 NAS6406U34 NAS6407U28D	NAS1291C3M NAS1291C4M NAS1291C5M NAS1291C6M NAS1291C7M	Tension	As Received
NAS6408U34 NAS6410U52H	109LH9074-8 109LH9074-10	Shear	As Received
NAS6403U12 NAS6404U15 NAS6405U31 NAS6406U34 NAS6407U28D	LH7875-3 LH7875-4 LH7875-5 LH7875-6 NAS679C7	Tension	As Received
NAS6408U34 NAS6410U52H	BMN4122C1S-8 BMN4122C1S-10	Shear	As Received
NAS6403U12	73178-1032	Tension	As Received
NAS6403U12 NAS6404U16 NAS6405U31 NAS6406U34 NAS6407U28D	NAS1291C3M NAS1291C4M NAS1291C5M NAS1291C6M NAS1291C7M	Tension	MIL-T-5544
NAS6408U34 NAS6410U52H	109LH9074-8 109LH9074-10	Shear	MIL-T-5544
NAS6403U12 NAS6404U16 NAS6405U31 NAS6406U34 NAS6407U28D	LH7875-3 LH7875-4 LH7875-5 LH7875-6 NAS679C7	Tension	MIL-T-5544
NAS6408U34 NAS6410U52H	BMN4122C1S-8 BMN4122C1S-10	Shear	MIL-T-5544

\* Sources of manufacturer's part numbers are shown below Table II.

**LOCKHEED • CALIFORNIA COMPANY**  
A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. LR 25049

PAGE NO. 9

TABLE I (Continued)

<u>Bolt</u> <u>Part No.</u> *	<u>Nut</u> <u>Part No.</u> *	<u>Combination</u> <u>Rating</u>	<u>Lubrication</u> <u>Condition</u>
NAS6403U12 NAS6404U16 NAS6405U31 NAS6406U34 NAS6407U28	LH7559-3 LH7559-4 LH7559-5 LH7559-6 NAS679A7	Tension	MIL-T-5544
NAS6408U34 NAS6410U52H	48FT-820 48FT-1018	Shear	MIL-T-5544
NAS6303U13D NAS6304U17D NAS6305U28D NAS6306U28 NAS6307U29H	NAS1291C3M NAS1291C4M NAS1291C5M NAS1291C6M NAS1291C7M	Tension	As Received
NAS6303U13D NAS6304U17D NAS6305U28D NAS6306U28 NAS6307U29H	NAS1291C3M NAS1291C4M NAS1291C5M NAS1291C6M NAS1291C7M	Tension	MIL-T-5544
NAS6303U13D NAS6304U17D NAS6305U28D NAS6306U28 NAS6307U29H	MS21043-3 MS21043-4 MS21043-5 MS21043-6 NAS679C7	Tension	MIL-T-5544
VEP220555-4-16 VEP220555-5-22 VEP220555-6-22 VEP220555-7-28 VEP220555-10-52	LH10205-4 LH10205-5 LH10205-6 LH10205-7 LH10205-10	Tension	MIL-T-5544
VEP220555-4-16 VEP220555-5-22 VEP220555-6-22 VEP220555-7-28 VEP220555-10-52	LH10205-4 LH10205-5 LH10205-6 LH10205-7 LH10205-10	Tension	MIL-L-23398
72914-7-36	LH10205-7	Tension	MIL-L-23398

\* Sources of manufacturer's part numbers are shown below Table II.

**LOCKHEED • CALIFORNIA COMPANY**

A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. LR 25049PAGE NO. 10**TABLE II - Preload Loss Test  
Specimen Combinations**

<u>Bolt Part No.</u>	<u>Nut Part No.</u> *	<u>Lubrication Condition</u>
NAS1103-12 NAS1104-17D NAS1105-22D NAS1106-24D	MS21042L3 MS21042L4 MS21042L5 MS21042L6	As Received
MS21250-04016	H49049-4	As Received
MS21250-04016 MS21250-05022 MS21250-06024 MS21250-07028	H49049-4 H49049-5 H49049-6 H49049-7	MIL-T-5544
MS21250-04016 MS21250-05022 MS21250-06024 MS21250-07028	H49049-4 H49049-5 H49049-6 H49049-7	MIL-L-23398
NAS6403U12 NAS6404U15 NAS6405U31 NAS6406U34	LH7559-3 LH7559-4 LH7559-5 LH7559-6	As Received
NAS6403U12 NAS6404U15 NAS6405U31 NAS6406U34	LH7875-3 LH7875-4 LH7875-5 LH7875-6	As Received
NAS6403U12 NAS6404U15 NAS6405U31 NAS6406U34	NAS1291C3M NAS1291C4M NAS1291C5M NAS1291C6M	As Received
NAS6303U13D NAS6304U17D NAS6305U28D NAS6306U28	NAS1291C3M NAS1291C4M NAS1291C5M NAS1291C6M	As Received

\* Sources of manufacturer's part numbers are shown below.

**LOCKHEED • CALIFORNIA COMPANY**

A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. LR 25049PAGE NO. 11

TABLE II - (Continued)

<u>Bolt</u> <u>Part No.</u> *	<u>Nut</u> <u>Part No.</u> *	<u>Lubrication</u> <u>Condition</u>
NAS6303U13D NAS6304U17D NAS6305U34D NAS6306U28	MS21043-3 MS21043-4 MS21043-5 MS21043-6	As Received
VEP220555-4-16 VEP220555-5-22 VEP220555-6-22	LH10205-4 LH10205-5 LH10205-6	MIL-T-5544
70718-4-16 70718-6-28	69678M428 69678M624	MIL-T-5544
70718V4-14 70718V6-23	69678M428 69678M624	MIL-T-5544
69680-4-18	69678M428	As Received
69680-4-18 69680-5-20 69680-6-19	69678M428 69678M524 69678M624	MIL-T-5544
69680V5-18 69680V6-24	69678M524 69678M624	MIL-T-5544

NOTE: All fastener combinations tested were considered to be tension rated. There were no shear rated fastener combinations tested.

\* Part Number Series

Manufacturer

BMN4122

H49049

LH10205, LH7559, LH7875, 109LH9074

VEP220555

48FT, 69678, 69680, 70718, 72914, 73178

Omark

Kaynar

ESNA

Valley Todeco

Standard Pressed Steel



**LOCKHEED • CALIFORNIA COMPANY**  
A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. \_\_\_\_\_

LR 25049

PAGE NO. \_\_\_\_\_

12

**IX. TEST SPECIMENS**

The test specimens consisted of a bolt, a nut, 2 washers, and a load cell assembled in a fixture. The load cells utilized strain gages so that loads could be determined. These load cells were designed to compensate for bending and therefore bending in the test specimen did not effect the load readings. The arrangement of the test set up is represented by Figure I.

**LOCKHEED • CALIFORNIA COMPANY**  
A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. LR 25049

PAGE NO. 13

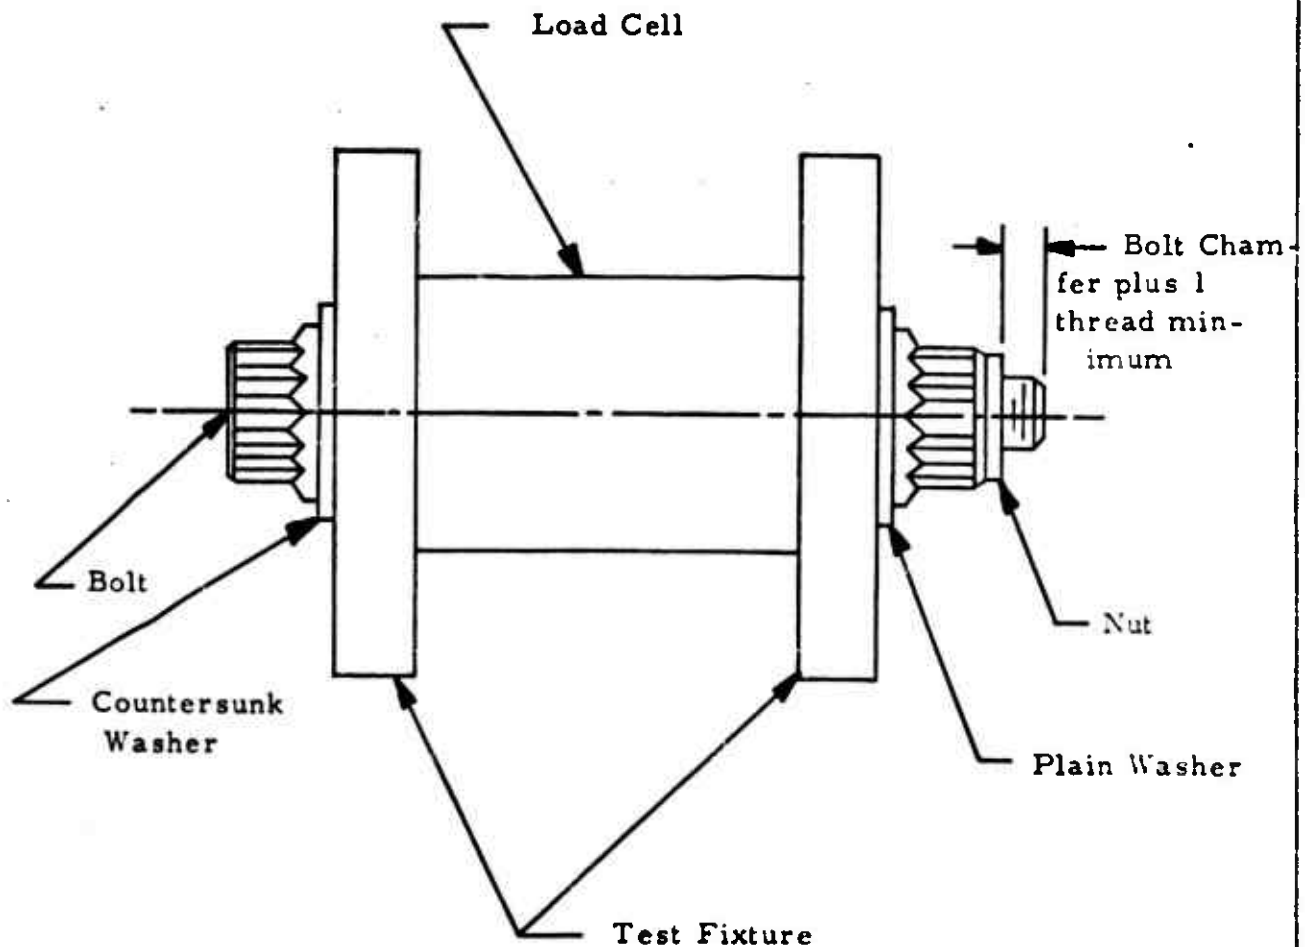


FIGURE 1 - TEST SET UP

**LOCKHEED • CALIFORNIA COMPANY**  
A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. LR 25049

PAGE NO. 14

**X. TEST PROCEDURE**

All tests were performed during the period between September 1, 1971 and December 23, 1971.

In order to preload the bolts to loads between 80 and 90 percent of yield strength it was necessary to determine bolt-nut combination yield strengths. Two methods were permitted. The first method was in accordance with Test 8 of MIL-STD-1312. This involves loading the nut and bolt axially in a tensile machine and obtaining a load-deflection curve. Bolt yield strength was then determined using Johnson's 2/3 approximate method. The second method utilized the torque-tension test fixture. Using a torque wrench, the nut was turned on to the bolt in increments of torque. Torque and strain were recorded for each increment. Torque was increased until strain readings indicated that the bolt-nut combination had been loaded past yield point or to failure. In subsequent tests the fasteners were loaded proportional to the yield strength as determined by either of these methods.

Torque-tension tests were conducted in accordance with Test 15 of MIL-STD-1312 except for the following. Compression load cells were used in conjunction with torque wrenches to determine the torque-tension relationships. The load cells were calibrated and calibration curves were obtained. Torque wrenches were accurate to within  $\pm 6$  percent.

**LOCKHEED • CALIFORNIA COMPANY**

A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. \_\_\_\_\_

LR 25049

PAGE NO. \_\_\_\_\_

15

**X. TEST PROCEDURE (Continued)**

Countersunk washers were placed under bolt heads, and plain washers were placed under the nut. Test specimens were assembled in the test fixture as represented by Figure I. Torque was applied in increments until strain readings approached values indicating that the desired preload of 80 to 90 percent of bolt-nut yield strength had been reached. The fastener was then disassembled and the procedure was repeated to obtain a second set of datum points. Where lubricants were added, they were applied to bolt threads and nut-washer interface in a conservative manner. The bolt head was held stationary and the nut was turned onto the bolt in all cases. Three specimens were tested for each test condition.

The preload-loss tests utilized the same test fixtures. The bolt-nut combination was preloaded to 80 to 90 percent of yield as indicated by strain readings. Strain readings were made at one hour intervals for the first eight hours, twice in the next 24 hours, and daily for the next two days. Total time for each test was not less than 70 hours. Application of torque was to the nut with the bolt held stationary. Lubricants, where used, were applied to the bolt threads and nut-washer interface in a conservative manner. The initial strain readings were made while the installation seating torque was maintained. The second strain reading was made 3 minutes after the

**LOCKHEED • CALIFORNIA COMPANY**

A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. \_\_\_\_\_

LR 25049

PAGE NO. \_\_\_\_\_

16

**X. TEST PROCEDURE (Continued)**

torque wrench was removed from the fastener. Three specimens were tested for each test condition.

All testing was conducted at room ambient temperature and humidity.

**LOCKHEED • CALIFORNIA COMPANY**  
A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. LR 25049

PAGE NO. 17

**XI. DISCUSSION OF TEST RESULTS**

The reduction of the test data was beyond the scope of this program and therefore no specific recommendations for installation torque limits are made herein.

Generally speaking the torque-tension tests indicated that there was considerable difference between the 3 individual specimens in a given group and between the groups of specimens of each thread size. For example, for all groups of .1900-32 threaded fasteners, installed to 40 inch pounds of torque, there was a difference of 1,739 pounds in the induced bolt preload between the lowest and highest values. For 160 KSI tension rated fasteners this amounts to 50% of the minimum ultimate tensile strength. This can be attributed to the differences in materials, finishes, lubricants, and the configuration of the parts tested. This amount of variation would indicate that one set of general torque limits is not going to utilize each fastener at its optimum capability.

Preload loss tests showed similar differences in the fastener preload as a result of the installation torque, however, the object of this portion of the program was to determine how loss of fastener preload varies in a static joint as a function of time. It was determined that every specimen lost some of its preload, and the loss varied between 1 and 11 percent. The greatest losses occurred in the first eight hours after installation. The preload appeared to be stabilizing by the end of the 72 hour observation period.



**LOCKHEED • CALIFORNIA COMPANY**

A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. \_\_\_\_\_

LR 25049

PAGE NO. \_\_\_\_\_

18

**XI. DISCUSSION OF TEST RESULTS (Continued)**

The extensive detailed test results are recorded in Almay Research and Testing Corporation Report Number A5417, and is available from Lockheed-California Company library. The accession number is 72-3296.

For those interested in further study of torque-tension relationships a bibliography of recent publications is appended to this report.

The appendix also includes an IDC which reports the results of a torque-tension test on the 1 inch diameter VEP220555 bolts and LH10205 nuts. This IDC has been included because this fastener is part of the series tested in this program. Since the information in this IDC supplements the data in this report, it has been included as part of this report.

**LOCKHEED • CALIFORNIA COMPANY**

A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. \_\_\_\_\_

LR 25049

PAGE NO. \_\_\_\_\_

19

XII.

APPENDIX

**LOCKHEED • CALIFORNIA COMPANY**  
A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. LR 25049

PAGE NO. 20

**LIST OF REFERENCES**

- (1) J. I. PRICE and D. K. TRASK - The Relation Between Torque and Tension for High Strength Fasteners. Bureau of Naval Weapons (BUWEPS) Report No. RAAE - 343-61-1. Prepared by the National Bureau of Standards, August 1961. Unclassified
- (2) H. S. BRENNER - Development of Technology for Installation of Mechanical Fasteners. National Aeronautics and Space Administration Report No. NASA CR-103179 (N71-26568). Prepared by Almay Research and Testing Corporation. 1971. Unclassified
- (3) H. S. BRENNER - Results of Torque-Tension Relationship Study Program of Various Structural Bolts and Mating Nuts Submitted by The Lockheed-California Company, Burbank, California. Almay Research and Testing Corporation Report No. A5417, December 23, 1971. Unclassified

# LOCKHEED • CALIFORNIA COMPANY

A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. LR 25049

PAGE NO. 21

## BIBLIOGRAPHY

Andrew J. Arnoldi - What's a Tight Fastener?,  
Assembly Engineering, August, 1971, pgs 24-27

Thomas C. Baumgartner and Francis R. Kull -  
Determining Preload in a Bolted Joint,  
Machine Design, February 13, 1964, Reprint

Harry S. Brenner - Fastener Specifications,  
Assembly Engineering, August 1964, Reprint

Robert A. Degen - Prevailing - Torque Locknuts -  
What They Are and Where They Should Be Used,  
Assembly Engineering, June 1970, pgs 30-34

Robert A. Degen - Prevailing - Torque Locknuts -  
What They Are and Where They Should Be Used..., Part 2  
Assembly Engineering, July 1970, pgs. 28-31

Ralph J. Erisman - Torque-Tension Relationships of  
Threaded Fasteners, Fasteners, Winter 1968/69,  
Volume 23, No. 4, pgs 9-11

Robert J. Finkelston - How Much Shake Can Bolted  
Joints Take?, Machine Design, October 5, 1972, pgs 122-125

James E. Foisy - Analysis of Nut and Bolt Torques, Part 2  
Assembly Engineering, January, 1968, pgs 20-22

Samuel C. Gambrell, Jr. - Why Bolts Loosen  
Machine Design, October 24, 1968, pgs 163-167

Frank L. Gill - Basic Fastener Functions in Environments  
of Mechanical Stress, Paper presented at U.C.L.A.  
Extension Course, Mechanical Fasteners,  
February 8-10, 1972

Fred Graves - Fastener Preload - Why?,  
Assembly Engineering, October 1970, pg 32

Fred Graves - Fastener Preload - How?,  
Assembly Engineering, November 1970, pg 32

**LOCKHEED • CALIFORNIA COMPANY**  
A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. LR 25049

PAGE NO. 22

**BIBLIOGRAPHY (Continued)**

Tom Green - Select Fasteners for Full Torque  
Research/Development, November 1966, Pgs 38-40

Tom Green - A New Discovery for Controlling the  
Torque/Tension Relationship  
Assembly Engineering, July 1972, Pgs 42-47

Ellsworth M. Gunther - Assembly Simplification  
With Torque-Tension Nomograms  
Assembly Engineering, October, 1969, Pgs 36-40

Rodger Hansen - Reader Feedback: The Turn-of-  
the-Nut Method (Continued)  
Assembly Engineering, August 1967, Pgs 18-22

A. G. Hopper and G. V. Thompson - Stress in Pre-  
loaded Bolts - Product Engineering, September 14, 1964  
Pgs 81-87

M. D. Hoza - The Turn-of-the-Nut Method  
Assembly Engineering, January 1967, Pgs 16-19

R. R. Irving - Who Knows How Tight is Tight  
Iron Age, October 3, 1968, Pgs 85-92

Gerhard H. Junker - New Criteria for Self-Loosening  
of Fasteners Under Vibration - SAE Paper 690055

Gehard Meyer, and Dieter Strelow - Simple Diagrams  
Aid in Analyzing Forces in Bolted Joints  
Assembly Engineering, January 1972, Pgs 28-33

Gehard Meyer, and Dieter Strelow - How to Calculate  
Preload Loss Due to Permanent Set in Bolted Joints  
Assembly Engineering, February 1972, Pgs 30-34

**LOCKHEED • CALIFORNIA COMPANY**

A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. LR 25049PAGE NO. 23**BIBLIOGRAPHY (Continued)**

Gehard Meyer, and Dieter Strelow - How to Calculate  
Preload Loss Due to Permanent Set in Bolted Joints, Part 2  
Assembly Engineering, March 1972, Pgs 28-31

W. P. McKay - Proper Thread Engagement by Nomogram  
Design News, March 6, 1972, Pgs 60-63

Carl C. Osgood - How Elasticity Influences Bolted-Joint  
Design, Spring Theory  
Machine Design, February 24, 1972, Pgs 92-95

Carl C. Osgood - How Elasticity Influences Bolted-Joint  
Design, Preload and Fatigue Concepts  
Machine Design, March 9, 1972, Pgs 104-107

E. B. Palmer - How Lubrication Affects Torque-Tension  
Relationships, Assembly and Fastener Engineering,  
September 1960, Pgs 36-42

Gerhard Schremmer - How to Keep Bolted Joints Tight  
Machine Design, September 1972, Pgs 140-145

Clarence R. Smith - Preventing Fatigue Failures  
Assembly Engineering, Parts 1 thru 3, March,  
April, May 1968, Reprint

Clarence Smith - Reflections, Technicalities, and  
Smith-Kabobs - Assembly Engineering, January 1970, Pg 33

C. F. Sternburg - Fastener Preload Control Current  
Technology - Lockheed-California Company Report  
No. LR 22839, 22 December 1969.

A. G. Tokarcik - The Torque-Tension Relationship  
Assembly Engineering, October 1966, Reprint



**LOCKHEED • CALIFORNIA COMPANY**

A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

REVISIONS \_\_\_\_\_

REPORT NO. LR25049

PAGE NO. 24

**BIBLIOGRAPHY (Continued)**

A. G. Tokarcik - Fastener System Concept,  
SAE Paper 670889, September 1967

An Answer to Torque Problems  
Production, March 1964, pgs 92-93

Bare Titanium Bolt, A-286 Nut Lube Evaluation  
Standard Pressed Steel, Precision Fastener Division  
Report No. 4976, April 28, 1972

Comparative Analysis of Environmental Physical and  
Mechanical Effects of Surface Conditioning and Dry  
Film Lubricants on Titanium Fasteners  
Voi-Shan Manufacturing Co. Engineering  
Report No. 459, October 21, 1969

Evaluation of Nut Materials and Finishes for Use  
on Titanium Bolts - Elastic Stop Nut Division,  
Amerace Esna Corp., October 31, 1969

High Reuse Performance Titanium Fasteners  
Elastic Stop Nut Division, Amerace Esna Corp.,  
ER288-2929-2, September 4, 1970

How Dangerous are Statically Loaded Machine Members?  
Product Engineering, December 1971, pgs 37-39

Joint Design - Machine Design, September 11, 1969, pgs 12-23

The Anatomy of a Problem: Proper Tightening of  
Machine Screws - Product Engineering, October 1971,  
pgs 21-23

The Suitability of Various Coatings and Lubricants for  
Use on Titanium Alloy Locknuts - Kaynar Mfg. Co., Inc.,  
Kaylock Division, ERM2709C, November 18, 1969

INTERDEPARTMENTAL COMMUNICATION

PE70/522

TO G. W. Davis

DEPT./ ORGN. 73-61 BLDG./ ZONE 90 PLANT/ FAC. A-1 DATE 7-28-70

FROM J. B. Bierbower


DEPT./ ORGN. 77-16 BLDG./ ZONE 80 PLANT/ FAC. A-1 EXT. 74943

SUBJECT: TORQUE-TENSION RELATIONSHIP - ENGINE TO PYLON ATTACH BOLTS

REF: Letter, BHG/1011-1844, dated 6-19-70

Tests were performed, as promised, to determine the torque value to be specified for subject bolts. Results of the tests run are attached.

If we may be of further service, please call.

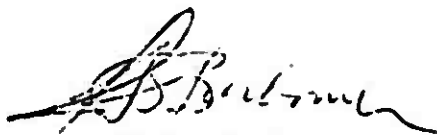

J. B. Bierbower  
Group Engineer, Mechanical Systems  
Parts and Equipment Department

JBB:JFJ:jb

cc: J. F. Jones  
J. A. Morgan  
M. VanDyl  
W. R. Zelcnka  
✓ PE File  
SP8P (VEP220555)

TORQUE-TENSION VEP 220555-16 INCONEL  
718 BOLT VS IH10205-16 SILVER PLATED A286 NUT

OBJECTIVE:

To determine the torque-tension relationship of 1.0000-12 UNJF Inconel 718 bolt and silver plated A286 nuts.

INTRODUCTION:

The L-1011 engine pylon attach bolts and nuts are 1.0000-12 UNJF thread size. The bolts are Inconel 718, part number VEP220555-16. The mating nuts are part number IH10205-16, made from A286 with silver-plated threads only. Data were not available in this combination of size and material so that the proper torque to provide the desired preload could be specified. Because of the critical nature of the engine attachment, it was necessary to perform torque-tension tests to determine the proper installation torque.

PROCEDURE:

The torque-tension tests were performed at Valley-Todoco, Inc. of Sylmar, California. Mr. Gene Bukont and Mr. Stewart Edwards, under the direction of Mr. Russ Sherman, performed the tests.

Test bolts were over runs from a lot of production bolts manufactured by Valley-Todoco. Test nuts were production nuts disbursed from Lockheed stock.

NOTE: The IH10205 nut should have silver-plated threads only. The parts obtained from stock had no plate. However, the samples used for these tests were silver plated all over at Valley-Todoco, and the plating was removed from the nut bearing surface prior to testing.

A Lockheed Electronics Company force washer, 1 inch I. D. Model No. 2016, was assembled on the bolt between hardened steel bushings to adjust for the bolt grip. The force washer was attached to a strain indicating gauge, Model P-350, manufactured by The Budd Co. A graph of the torque-strain relationship for a bolt of this size and material had previously been prepared and is shown on Figure 1. The silver-plated nut was assembled on the bolt. The assembled bolt, force washer, bushing and nut assembly was then placed in a 5 to 1 torque multiplier fixture. Torque was applied in approximately 75 ft-lb increments, using a P. A. Sturtevant Co. torque wrench, Model No. S-600 (0-600 ft-lb range). Strain gauge readings were taken at each torque increment and recorded. The applied load was then determined from Figure 1.

The above test was repeated except MIL-T-5544 lubricant was applied to the bolt thread. This assembly was torqued and the results tabulated in Table III and plotted on Figure 2.

### RESULTS AND DISCUSSION:

The length of torque wrench arm, 5 feet, made it impossible to apply the torque continuously. In some instances, between intervals, the wrench had to be removed from the fixture socket and repositioned in order to fully apply the next increment of torque. This may account for some of the erratic results. In the first test yielding in the system was observed near 1500 ft-lbs of torque. Further application of torque produced a failure in one of the socket drive inserts in the multiplier fixture. The test was rerun using the same fasteners. The results of both of these tests are reported in Table I and Table II and plotted in Figure 2. From the graph it appears that approximately 1250 ft-lbs of torque is required to obtain 70,000 lbs preload in the bolt when a silver-plated nut, with no subsequent lubricant, is used. This torque could exceed 1700 ft-lbs after the first use if the "2nd run" curve of Figure 2 was extended.

The required torque dropped drastically as would be expected when MIL-T-5544 anti-seize lubricant was applied to the bolt thread. The curve of this data indicates only about 600 ft-lbs torque required for 70,000 lbs preload in the bolt. It is expected that some loss of preload would also occur if this assembly was reused. However, preload would probably be restored if the bolt was relubricated before assembly.

### CONCLUSIONS:

The engine to pylon attach bolts should be lubricated prior to assembly with MIL-T-5544 anti-seize applied to bolt threads. The assembly should be torqued to 600 ft-lbs. The engineering installation drawings should be reviewed and an installation torque, in accordance with this data, be specified.

### TEST WITNESSES:

The above tests were witnessed by the following Lockheed personnel:

Jim Jones	Dept. 77-16
Mike VanDyl	Dept. 53-73

TABLE I

VEP220555-16 Bare Inconel 718 Bolt -  
 IH10205-16 Silver-Plated Nut

<u>Torque</u> Ft.-lbs	<u>Strain Gauge</u> <u>Reading In/In</u>	<u>Load</u> lbs x 10 <sup>3</sup>
250	1.15	13.2
325	1.22	14.2
500	2.46	27.8
625	2.60	29.5
750	3.17	35.5
875	3.78	42.0
1000	4.42	49.3
1125	5.47	60.7
1250	5.50	61.2
1375	6.80	75.5
1500	6.91	77.0

TABLE II

VEP220555-16 Bare Inconel 718 Bolt -  
 IH10205-16 Silver-Plated Nut - 2nd Run (1)

<u>Torque</u> Ft.-lbs	<u>Strain Gauge</u> <u>Reading In/In</u>	<u>Load</u> lbs x 10 <sup>3</sup>
375	1.74	20.0
500	1.74 (2)	20.0
625	2.34	26.5
750	2.46	27.1
875	3.22	36.0
1000	3.22 (2)	36.0
1125	4.03	45.5
1375	5.60	62.5
1500	5.80	64.5
1625	6.24	69.5
1750	6.36	70.7
1875	7.27	80.5
2000	7.59	84.5

(1) Socket drive sheared off after 1500 ft-lbs. Test rerun with same bolt and nut.

(2) No change seen in strain gauge.

TABLE III

VEP220555-16 Bare Bolt, Threads  
Coated with MIL-T-5544 Anti-Seize -  
IH10205-16 Silver-Plated Nut

<u>Torque</u> <u>Ft-Lbs</u>	<u>Strain Gauge</u> <u>Reading In/In</u>	<u>Load</u> <u>Lbs x 10<sup>3</sup></u>
250	2.09	24.0
375	4.06	45.5
500	5.73	64.0
625	6.81	75.5
750	8.03	89.5

$$T = \frac{R \text{ Pbi}}{Ar} \quad (\text{From SM79b dtd January 15, 1970})$$

where T = Wrench Torque, in lbs

R = Wrench Torque ratio (from Table VII of SM79b)

Pbi = Preload in bolt due to tightening, lbs

Ar = Root area of bolt, sq. in.

for 1.0000-12 UNJF:

R = 0.04993 for MIL-T-5544 lubricant

= 0.06675 for MIL-T-23398 lubricant

NOTE: R values are for cadmium plated steel bolts and fitting and are being used only for approximation of test results

Ar (MIL-8-8879) = .64156

Pbi = Ar x 100,000 psi = 64,156 lbs  
or = 70,000 lbs

● 64,156 lbs w/MIL-T-5544

$$T = \frac{.04993 \times 64,156}{.64156}$$

$$= 4993 \text{ in-lbs}$$

$$= 4.6 \text{ ft-lbs}$$

● 70,000 lbs w/MIL-T-5544

$$T = \frac{.04993 \times 70,000}{.64156}$$

$$= 5447 \text{ in-lbs}$$

$$= 4.54 \text{ ft-lbs}$$

● 64,156 lbs w/MIL-L-23398

$$T = \frac{.06675 \times 64,156}{.64156}$$

$$= 6675 \text{ in-lbs}$$

$$= 5.56 \text{ ft-lbs}$$

● 70,000 lbs w/MIL-L-23398

$$T = \frac{.06675 \times 70,000}{.64156}$$

$$= 7282 \text{ in-lbs}$$

$$= 6.07 \text{ ft-lbs}$$


500 ft-lbs

$$Pbi = \frac{T \text{ Ar}}{R} = \frac{6000 \times .64156}{.04993} = 77,100 \text{ lbs}$$

PREPARED BY \_\_\_\_\_  
DATE \_\_\_\_\_  
CHECKED BY \_\_\_\_\_

LOCKHEED-CALIFORNIA COMPANY  
A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

PAGE \_\_\_\_\_  
MODEL \_\_\_\_\_  
REPORT NO. LR 25049  
Pg. 31

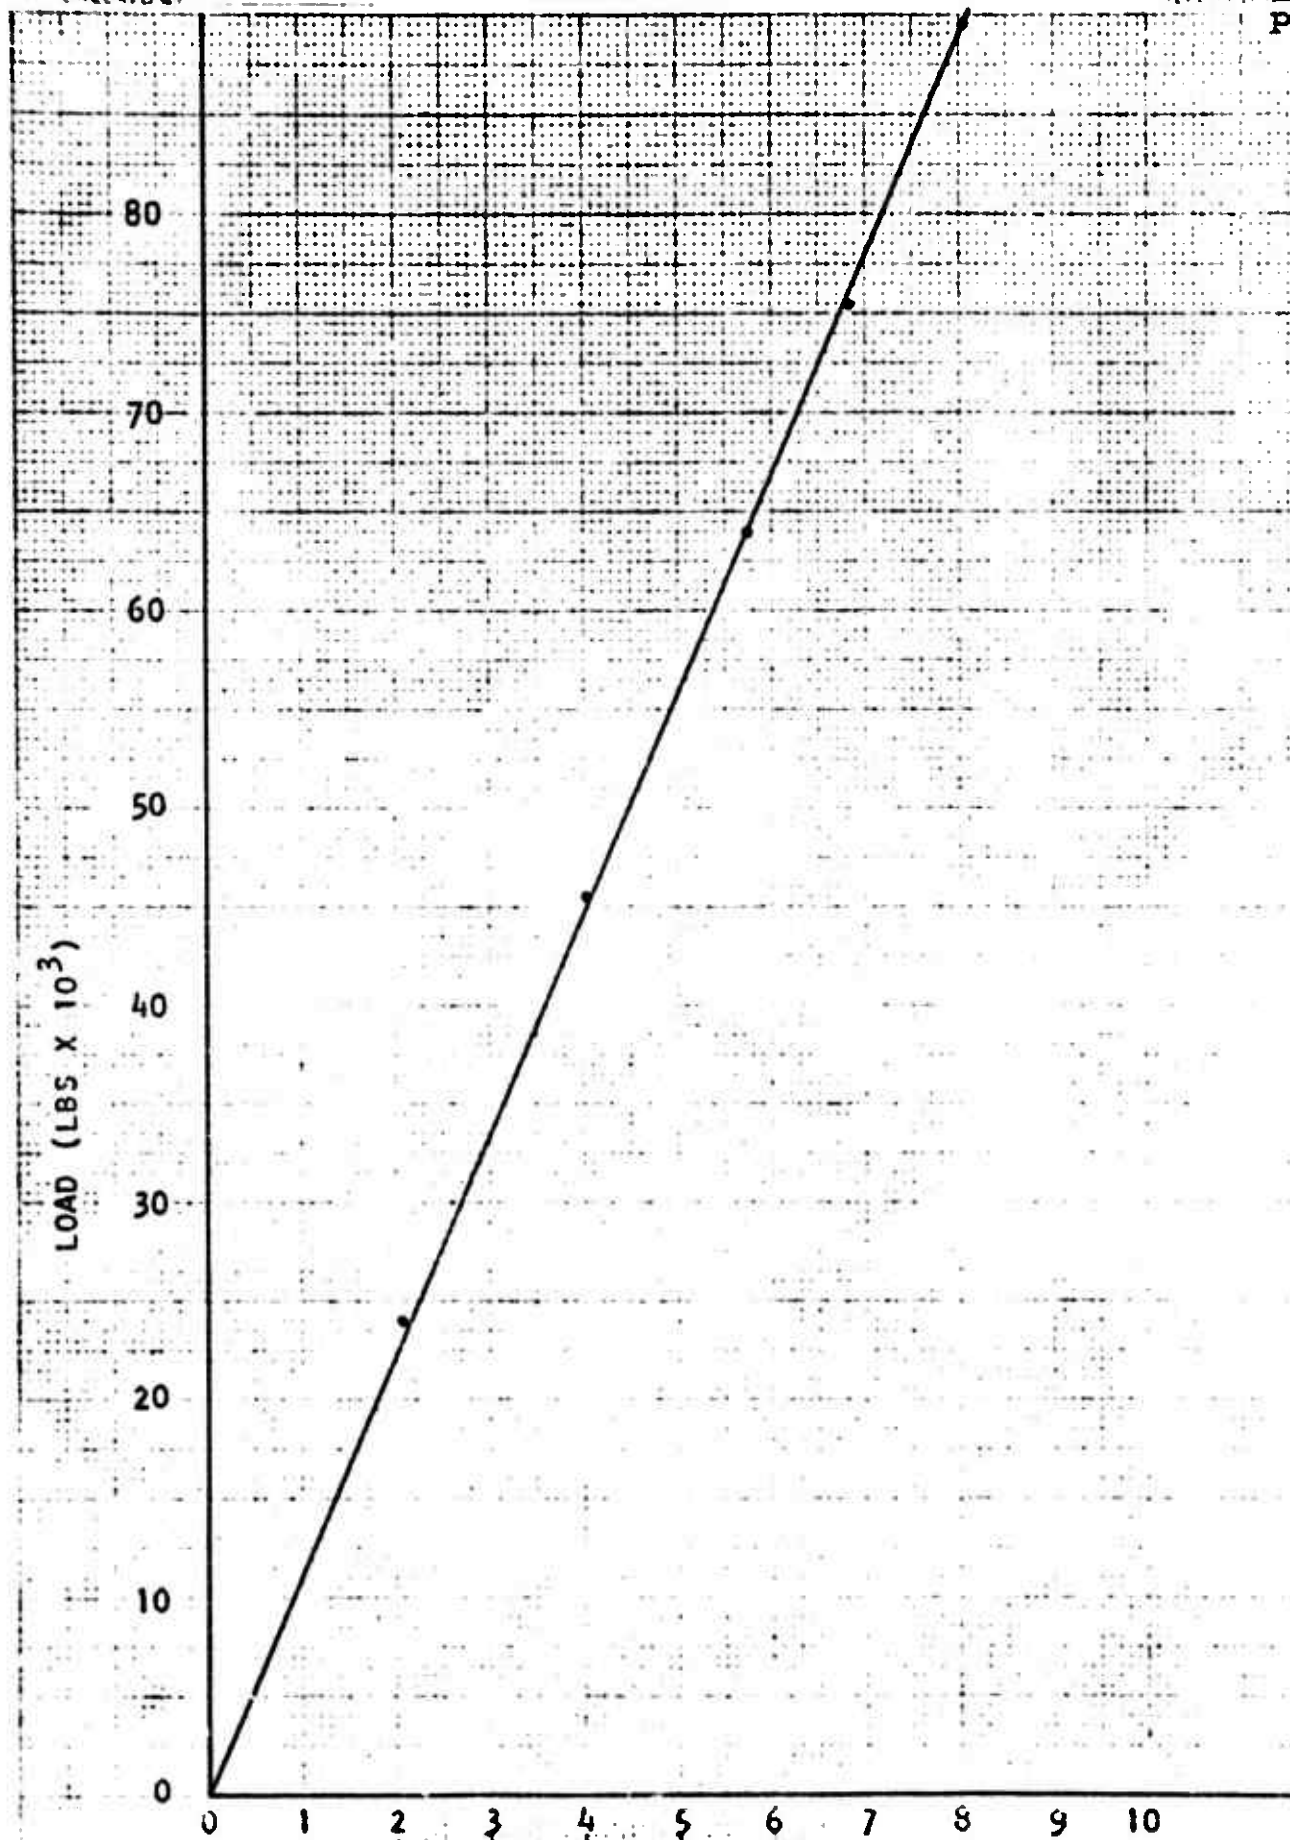


T-T TESTS VEP220555-16  
STRAIN - (IN./IN.)



PREPARED BY \_\_\_\_\_  
 DATE \_\_\_\_\_  
 CHECKED BY \_\_\_\_\_

LOCKHEED-CALIFORNIA COMPANY  
 A DIVISION OF LOCKHEED AIRCRAFT CORPORATION

PAGE \_\_\_\_\_  
 MODEL \_\_\_\_\_  
 REPORT NO. LR 25049  
 Pg. 32

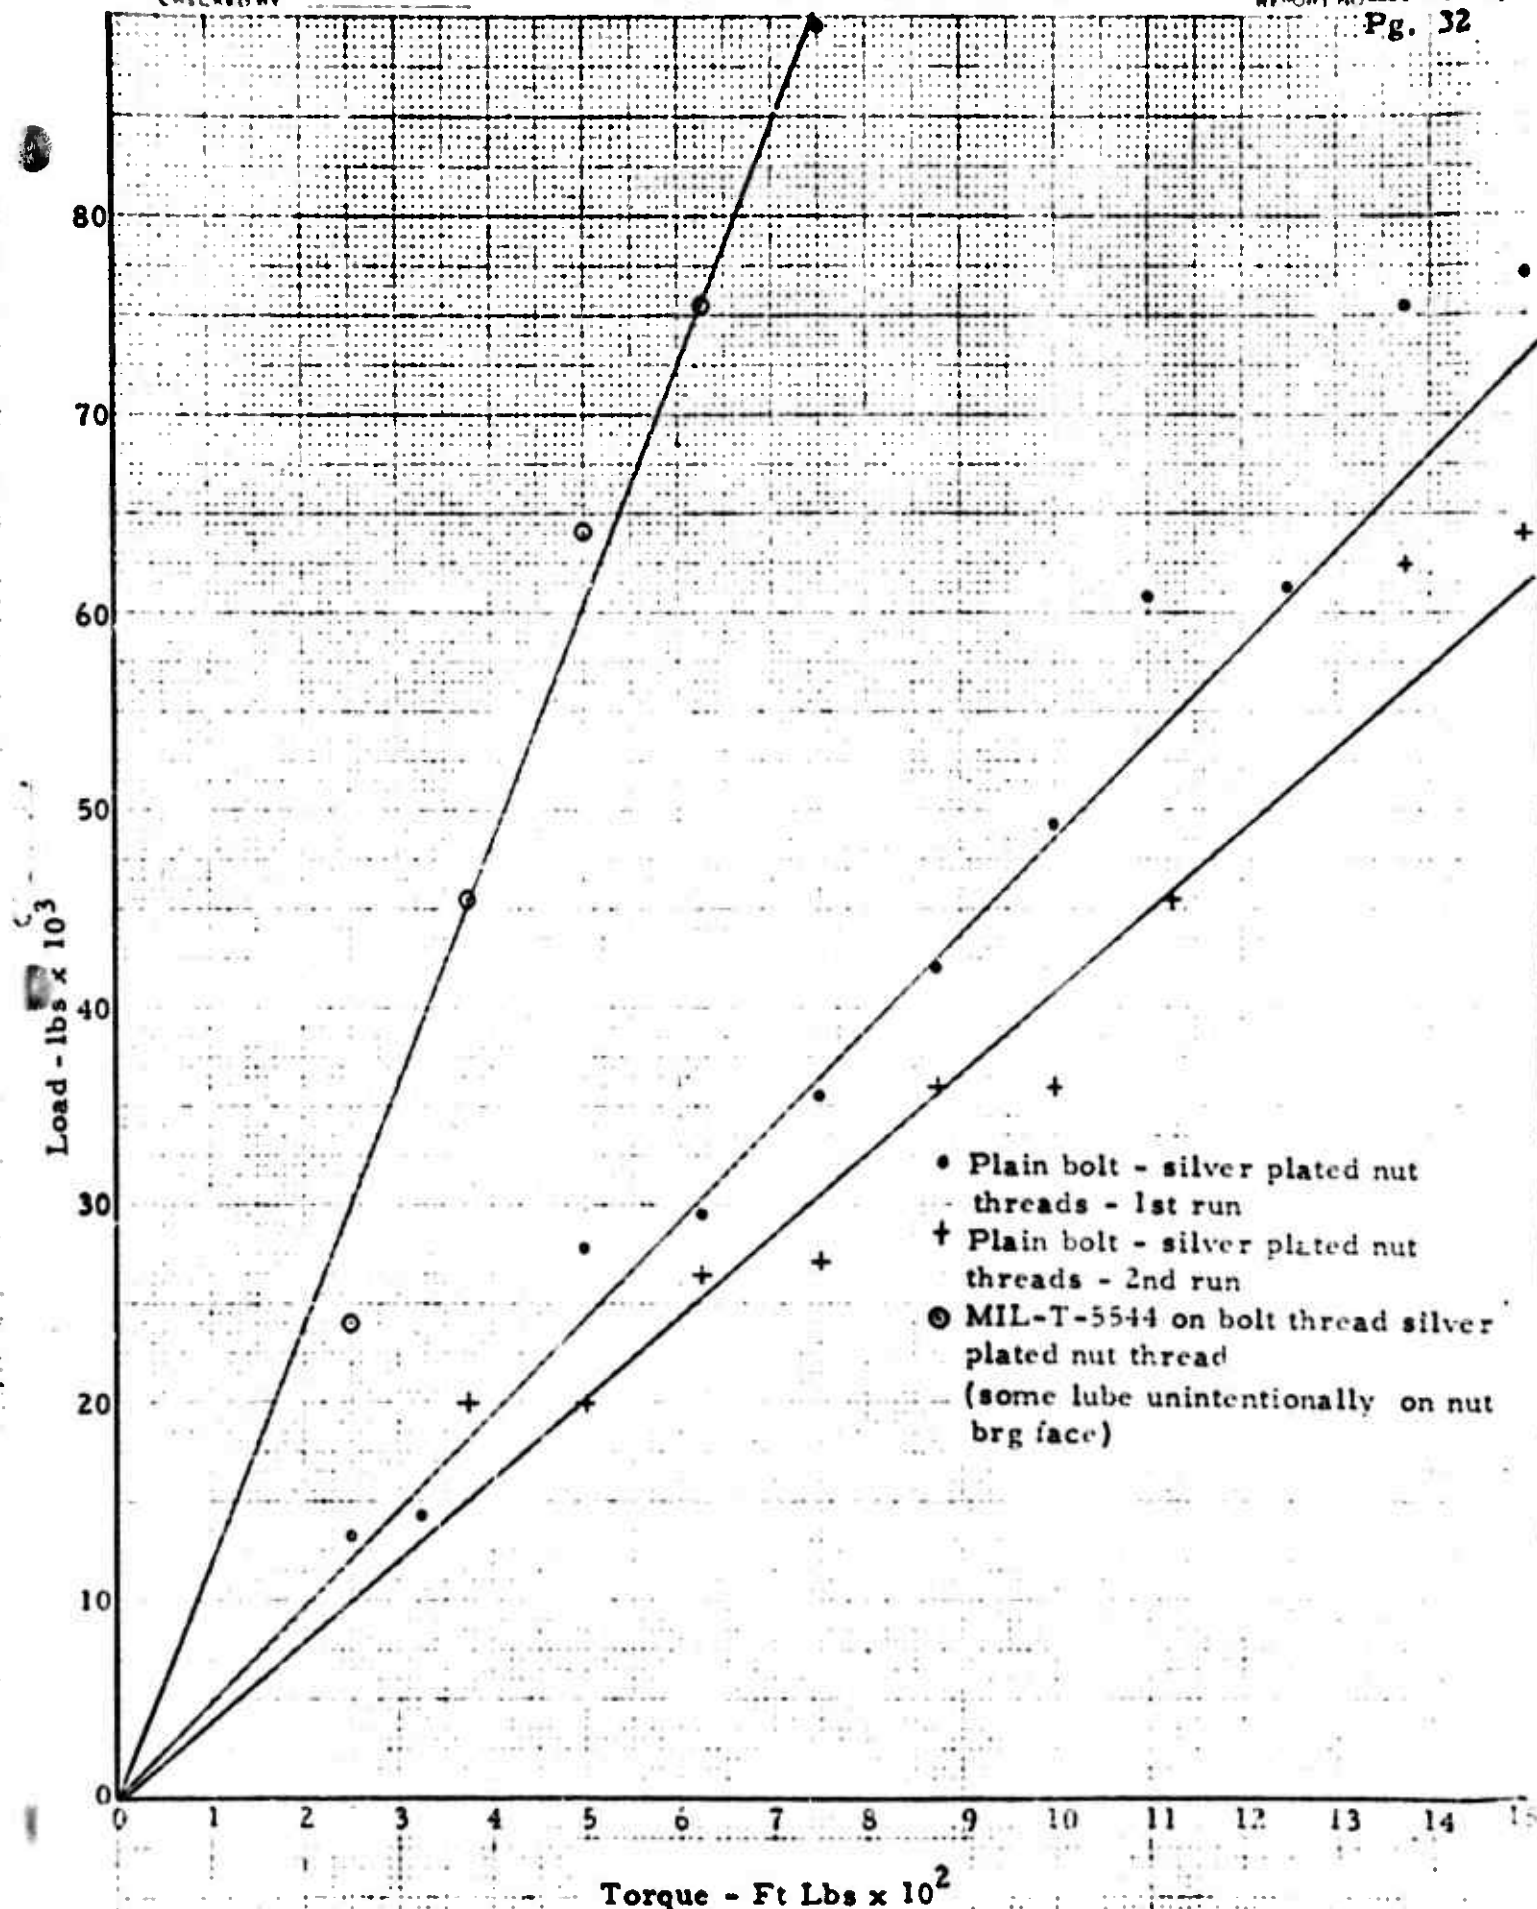

Torque - tension VEP220555-16 bolt (bare Inconel) vs LH10205-16 (Silver plated A286) nut